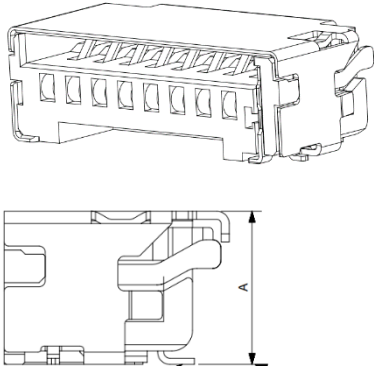


PCN Overview

PCN Number		DHCOM-iMX6ULL-001	
PCN Date		23.12.2021	
Type of Change		Change of Component	
History			
Revision	Date	Description	Name
R01	13.09.2021	First draft	AG
R01	22.12.2021	Approved & Released	AB

Change Information

Reason of Change	Obsolescence/Availability/Second Source
Description of Changes	Qualification and Introduction of additional microSD-socket Current Slot: Molex 47309-5251 or 47309-3351 New/additional slot: Molex 47309-2651 (different height / lower than the two alternatives)  47309-5251: A = 5.25 mm 47309-3351: A = 3.35 mm 47309-2651: A = 2.65 mm
Customer Impact	All modules with microSD-slot can be equipped with all three types of the microSD sockets.
Suggested Measures	DH advises customers to carefully validate the new product version before their production release.
Logistics	Please ask your sales contact if you have any questions about this change.

Affected Products	
HI00063	DHCM-iMX6ULL-C090-R051-F0409-SPI-E2-CAN2-SD-RTC-ADC-C-01D2
HI00077	DHCM-iMX6ULL-C052-R025-F0012-SPI-E-SD-RTC-C-01D2
HI00090	DHCM-iMX6ULL-C080-R051-F0409-SPI-E2-CAN2-SD-RTC-ADC-I-01D2
HI00096	DHCM-iMX6ULL-C052-R025-F0012-SPI-E-SD-RTC-C-01D2
HI00099	DHCM-iMX6ULL-C080-R051-F0409-SPI-E2-CAN2-SD-RTC-ADC-I-01D2
FI00043	DHCM-iMX6ULL-C052-R025-F0012-SPI-E-SD-RTC-C-01D2

Contacts	
Technical Contact	Tel: +49 8662 4882 0 Mail: support@dh-electronics.com
Sales Contact	Tel: +49 8662 4882 0 Mail: sales@dh-electronics.com